

September 21, 2022
2017-116.006

Mr. Wayne Lee
Los Angeles County Public Works
900 South Fremont Avenue, 9th Floor
Alhambra, California 91803

Re: *Devil's Gate Reservoir Restoration Project – Phase 2 Restoration Qualitative Monitoring Conducted on August 26, 2022*

1.0 INTRODUCTION

The purpose of this letter report is to document the results of qualitative (horticultural) monitoring conducted for the Devil's Gate Reservoir Restoration Project (Project), located in the City of Pasadena, Los Angeles County, California. The qualitative monitoring was conducted in the planted and or seeded portions of the Phase 2 mitigation areas including DG-W-1 (Johnson Field), DG-2, DG-2 New Channels, DG-2 WOUS, DG-W-2 (Mining Pit), DG-W-2 Outlet, DG-4 Sheet Flow (northern), and DG-SF-1. Other areas included in Phase 2 include DG-4 Sheet Flow (southern), DG-4 WOUS, DG-4 Drainage, and DG-SF-2; however, due to the dynamic nature of these areas and/or uncertainty of hydrologic conditions prior to the completion of sediment removal for the Project, these areas were not planted or seeded during Phase 2. It is anticipated that most, if not all, of these areas will be planted with willow (*Salix* sp.) and mulefat (*Baccharis salicifolia*) stakes during the fall and winter of 2022/2023. The monitoring is being conducted in accordance with the Final Habitat Restoration Plan for the Project (HRP). The initial sediment removal in the reservoir was completed in 2021 and the annual maintenance removal phase will be initiated in September of 2022. The only Project activity currently being conducted is the habitat restoration around the perimeter of the sediment removal areas.

ECORP is responsible for conducting qualitative monitoring and compliance review of restoration efforts in each of the mitigation areas. ECORP is also responsible for preparing monitoring reports, which typically include the following information:

- Overall health of container plants
- Observations and recommendations related to container plant establishment
- Germination of native plant species from seed application and natural recruitment
- Level of germination of nonnative plant species
- Soil condition

- Other observations and recommendations as appropriate

Qualitative monitoring was conducted by Carley Lancaster on August 26, 2022. Field data collected during the monitoring event is provided as Attachment A. This report documents the second quarterly qualitative monitoring visit for the Phase 2 mitigation areas.

2.0 QUALITATIVE MONITORING IN THE PHASE 2 MITIGATION AREAS

2.1 Brief Summary of Plant Installation

During the Phase 2 Installation effort, which was completed on May 5, 2021, a total of 11,440 one-gallon container plants were installed in the DG-W-1 (Johnson Field), DG-W-2 (Mining Pit), DG-W-2 Outlet, DG-2, DG-2 New Channels, DG-2 WOUS, DG-4 Sheet Flow (northern), and DG-SF-1 mitigation areas. Container plants were not installed in the DG-4 Sheet Flow (southern), DG-4 WOUS, DG-4 Drainage, or DG-SF-2 mitigation areas; however, these areas were included in the weed removal effort and will be planted with willow and mulefat stakes in the fall and winter of 2022/2023. Table 1 lists container plant species and the numbers installed in each of the Phase 2 mitigation areas.

Scientific Name	Common Name	DG-					TOTAL
		DG-W-1 (Johnson Field)	DG-2/ DG-2 New Channels/ DG-2 WOUS	DG-W-2 (Mining Pit)	DG-W-2 Outlet	DG-4 Sheet Flow/ DG-SF-1	
<i>Artemisia douglasiana</i>	Mugwort	349	448	187	50	31	1,065
<i>Baccharis pilularis</i>	Coyote brush	349	375	187	50	31	992
<i>Baccharis salicifolia</i>	mulefat	673	827	228	61	37	1,826
<i>Populus fremontii</i>	Fremont's cottonwood	349	375	187	50	31	992
<i>Rosa californica</i>	California rose	349	375	187	50	31	992
<i>Rubus ursinus</i>	California blackberry	349	375	141	38	23	926
<i>Salix gooddingii</i>	Black willow	698	896	373	101	61	2,129
<i>Salix laevigata</i>	Red willow	349	375	187	50	31	992
<i>Salix lasiolepis</i>	Arroyo willow	349	375	187	50	31	992
<i>Sambucus mexicana</i>	Mexican elderberry	175	225	94	25	15	534
Total		3989	4646	1958	525	322	11,440

All plants were installed according to the methods described in Section 4.11 of the HRP. Planting holes for all container plants were dug to a width twice the size of the root ball and to a depth slightly deeper than the depth of the root ball so that the root crown was one inch below grade following installation. Prior to installation, all plants were thoroughly watered in their containers and the soil in planting holes was wetted with at least one gallon of water. Planting holes were backfilled with native soil and irrigation basins, approximately two feet in width, were formed around the base of each plant. Rocks greater than

two inches in diameter were removed to the extent possible from the backfill soil. All container plants were irrigated with at least one gallon of water immediately following installation and basin creation.

2.2 Qualitative Monitoring Methods

Qualitative monitoring occurs monthly following the 120-day Plant Establishment Period (PEP) for the remainder of Year 1 (8 months). Following Year 1, qualitative monitoring will occur quarterly during Years 2 and 3 and twice per year during Years 4 through 10. The purpose of the qualitative monitoring is to assess container plant health and vigor and monitor the success of the mitigation areas.

During the August 26, 2022 visit, all Phase 2 mitigation areas were walked, the health and vigor of container plants were documented, germination from seeding and natural recruitment was noted, and the irrigation lines were inspected for functionality. In addition, the level of nonnative and invasive weed cover was estimated for each of the Phase 2 mitigation areas.

2.3 Qualitative Monitoring Results

2.3.1 DG-W-1 (Johnson Field)

The overall health of the container plants in DG-W-1 was noted as being good. Approximately 10 to 15 percent of the container plants in DG-W-1 were noted as showing varied levels of stress and a negligible number were noted as being dead or missing. This is approximately five percent more than the percentage of plants that were showing stress during the last monitoring event. Stress appears to primarily be the result of drought stress from recent high temperatures but may also be occurring as a result of 1) herbivory by rabbits or other wildlife, 2) competition from nonnative and invasive weeds, 3) misplaced emitters, or 4) recreational traffic through the mitigation areas. In addition, some of the mulefat (*Baccharis salicifolia*) in this mitigation area were showing signs of minor dieback that appeared to be the result of *Baccharis* leaf blister and/or dodder (*Cuscuta* sp.). A handful of Fremont's cottonwoods (*Populus fremontii*) were also showing minor dieback which appeared to be the result of natural recruitment of mulefat within their basins. Evidence of dieback from *Phytophthora cactorum*, including wilting, stunted growth, leaf spotting, and/or browning along leaf margins and tips, was not observed on any of the container plants. The willows (*Salix* sp.) and Fremont's cottonwoods (*Populus fremontii*) in this mitigation area were no longer showing signs of seasonal dieback. Formal mortality counts were taken for DG-W-1 during the 2021 and 2022 quantitative monitoring events. Some of the container plants were noted as lacking well defined basins and should have their basins properly constructed and/or repaired. The irrigation line appeared to be functioning properly for most areas of the mitigation area during the monitoring visit; however, some basins appeared to be dry and should be inspected for functionality. The installation of plants in the DG-W-1 mitigation area appears to have been completed successfully. The current issues identified during the monitoring visit are not expected to have an effect on the continued growth of the plants in the mitigation area. Photos 1 and 2 in Attachment B document the mitigation area during the monitoring visit.

Native plant growth was noted throughout the DG-W-1 mitigation area, likely from both natural recruitment and from seeding. Native plants such as annual bursage (*Ambrosia acanthicarpa*), mugwort

(*Artemisia douglasiana*), mulefat, tall flatsedge (*Cyperus eragrostis*), Canada horseweed (*Erigeron canadensis*), and slender buckwheat (*Eriogonum gracile*) were observed sprouting in the DG-W-1 mitigation area. In addition, dodder was observed growing on some of the young container plants during the monitoring visit and should be removed. Native cover was estimated to be approximately 60 percent in the DG-W-1 mitigation area.

Nonnative weed cover in DG-W-1 was estimated at approximately less than one percent, which is approximately one percent less than the level of weed cover that was observed during the previous monitoring visit. Nonnative species observed in DG-W-1 included black mustard (*Brassica nigra*) and cheeseweed mallow (*Malva parviflora*). All of the nonnative weeds observed in this mitigation area were still vegetative and just beginning to germinate.

2.3.2 DG-2/DG-2 New Channels/DG-2 WOUS

The overall health of the container plants in DG-2, DG-2 New Channels, and DG-2 WOUS was noted as being good. Approximately less than five percent of the container plants were noted as showing varied levels of stress and a negligible number were noted as being dead or missing. This is approximately the same percentage of plants that were showing stress during the last monitoring event. Stress may be occurring due to similar reasons described for DG-W-1. Evidence of dieback from *Phytophthora cactorum*, including wilting, stunted growth, leaf spotting, and/or browning along leaf margins and tips, was not observed on any of the container plants. Similar to DG-W-1, the willows and Fremont's cottonwoods in this mitigation area were no longer showing seasonal dieback. Formal mortality counts were taken for DG-2, DG-2 New Channels, and DG-2 WOUS during the 2021 and 2022 quantitative monitoring events. Some of the container plants were noted as lacking well defined basins and should have their basins properly constructed and/or repaired. The irrigation line appeared to be functioning properly during the monitoring visit. During the monitoring visit, the grade control structure that was installed at the northern end of DG-2 New Channels where the channels connect to DG-W-1 was inspected for erosion. Minor erosion was observed, mostly towards the western end of the structure; however, no major erosion issues were observed, and the structure appears to be functioning properly. The installation of plants in the DG-2, DG-2 New Channels, and DG-2 WOUS mitigation areas appears to have been completed successfully. The current issues identified during the monitoring visit are not expected to have an effect on the continued growth of the plants in the mitigation area. Photos 3 through 6 in Attachment B document the mitigation areas during the monitoring visit. Photos 15 and 16 in Attachment B document the condition of the grade control structure during the monitoring visit.

Native plant growth was noted throughout the DG-2, DG-2 New Channels, and DG-2 WOUS mitigation areas, likely from both natural recruitment and from seeding. Native plants such as annual bursage, mugwort, mulefat, Canada horseweed, and telegraph weed (*Heterotheca grandiflora*) were observed sprouting in the mitigation areas. In addition, dodder was observed growing on some of the young container plants towards the southern end of the mitigation area during the monitoring visit and should be removed. Native cover was estimated to be approximately 65 percent in the DG-2, DG-2 New Channels, and DG-2 WOUS mitigation areas.

Nonnative weed cover in the DG-2, DG-2 New Channels, and DG-2 WOUS mitigation areas was estimated at approximately less than one percent, which is approximately four percent less than the percentage that was observed during the last monitoring visit. Nonnative species observed included poison hemlock (*Conium maculatum*), and perennial pepperweed (*Lepidium latifolium*). All of the nonnative weeds observed in this mitigation area were vegetative and just starting to germinate.

2.3.3 DG-W-2 (Mining Pit)

The overall health of the container plants in mitigation area DG-W-2 was noted as being good. Approximately 20 to 25 percent of the container plants were noted as showing varied levels of stress and a negligible number were noted as being dead or missing. This is approximately 15 to 20 percent higher than the percentage of plants that were showing stress during the last monitoring event. Stress may be occurring due to similar reasons described for DG-W-1. Evidence of dieback from *Phytophthora cactorum*, including wilting, stunted growth, leaf spotting, and/or browning along leaf margins and tips, was not observed on any of the container plants. Formal mortality counts were taken for DG-W-2 during the 2021 and 2022 quantitative monitoring events. Some of the container plants were noted as lacking well defined basins and should have their basins properly constructed and/or repaired. The irrigation line appeared to be functioning properly for most areas of the mitigation area during the monitoring visit; however, some basins appeared to be dry and should be inspected for functionality. The installation of plants in the DG-W-2 mitigation area appears to have been completed successfully and the issues noted during the monitoring are not expected to have an impact on the continued growth of the plants. Photos 7 through 9 in Attachment B document the mitigation area during the monitoring visit.

During the monitoring visit, it was noted that many of the existing mature black willow (*Salix gooddingii*) in this mitigation area were continuing to show additional dieback and additional branch failure. Signs of infestation from the polyphagous shot-hole borer (PSHB) noted during previous monitoring visits included entry/exit holes, frass, galleries, fungal residue, and branch failure. Further investigation into this issue is being conducted with the help from the Los Angeles County Department of Agricultural Commissioner/Weights & Measures (ACWM) and preliminary surveys mostly showed only low to moderate infestation in these areas. It should be noted that evidence of infestation was only noted on existing mature willows and not on any of the recently installed container plants. It should also be noted that many of the existing willows showing dieback were showing significant new growth.

Native plant growth was noted throughout the DG-W-2 mitigation area, and what was present is likely from both natural recruitment and from seeding. Native plants such as annual bursage, mulefat, Canada horseweed, thick-leaved yerba santa (*Eriodictyon crassifolium*), telegraph weed, and rough cocklebur (*Xanthium strumarium*) were observed sprouting in the DG-W-2 mitigation area. It was noted that the dodder observed growing on some of the young container plants during previous monitoring visits had been removed. Native cover was estimated to be approximately 65 percent in the DG-W-2 mitigation area.

Nonnative weed cover in DG-W-2 was estimated at approximately less than five percent in the mitigation area, which is approximately five percent less than the level of nonnative cover that was observed during the last monitoring event. Nonnative species observed in DG-W-2 included black mustard, poison

hemlock, and perennial pepperweed. Most of the nonnative weeds observed in this mitigation area were vegetative and just starting to germinate.

2.3.4 DG-W-2 Outlet

The overall health of the container plants in mitigation area DG-W-2 was noted as being good. Approximately 25 to 30 five percent of the container plants were noted as showing varied levels of stress and a negligible number were noted as being dead or missing. This is approximately 20 to 25 percent higher than the percentage of plants that were showing stress during the last monitoring event. Stress may be occurring due to similar reasons described for DG-W-1. Evidence of dieback from *Phytophthora cactorum*, including wilting, stunted growth, leaf spotting, and/or browning along leaf margins and tips, was not observed on any of the container plants. Formal mortality counts were taken for DG-W-2 Outlet during the 2021 and 2022 quantitative monitoring events. Some of the container plants were noted as lacking well defined basins and should have their basins properly constructed and/or repaired. In addition, mature willows in this area were noted as having branch failure, likely due to recent high winds. The irrigation line appeared to be functioning properly for most areas of the mitigation area during the monitoring visit; however, some basins appeared to be dry and should be inspected for functionality. The installation of plants in the DG-W-2 Outlet mitigation area appears to have been completed successfully and the issues noted during the monitoring are not expected to have an impact on the continued growth of the plants. Photos 10 through 13 in Attachment B document the mitigation area during the monitoring visit.

Native plant growth was noted throughout the DG-W-2 Outlet mitigation area, and what was present is likely from both natural recruitment and from seeding. Native plants such as annual bursage, mugwort, mulefat, Canada horseweed, telegraph weed, and rough cocklebur were observed sprouting in the DG-W-2 Outlet mitigation area. Dodder that was previously noted on container plants appears to have been removed during recent maintenance activities. Native cover was estimated to be approximately 60 percent in the DG-W-2 Outlet mitigation area.

Nonnative weed cover in DG-W-2 Outlet was estimated to be approximately less than one percent, which is approximately nine percent less than the percentage of weed cover that was observed during the previous monitoring visit. Nonnative species observed in DG-W-2 included poison hemlock and perennial pepperweed, All nonnative weeds observed in this mitigation area were vegetative and just starting to germinate.

2.3.5 DG-4 Sheet Flow/DG-SF-1

The overall health of the container plants in mitigation areas DG-4 Sheet Flow (northern) and DG-SF-1 was noted as being good. Approximately five percent of container plants were showing varied levels of stress which is approximately the same percentage of container plants that were showing stress during the previous monitoring event. Stress may be occurring due to similar reasons described for DG-W-1. Evidence of dieback from *Phytophthora cactorum*, including wilting, stunted growth, leaf spotting, and/or browning along leaf margins and tips, was not observed on any of the container plants. Formal mortality counts were taken during the 2021 and 2022 quantitative monitoring events. Some of the container plants were noted as lacking well defined basins and should have their basins properly constructed and/or

repaired. In addition, minor herbivory of young plants was observed within the DG-4 Sheet Flow and DG-SF-1 areas and should continue to be monitored. The irrigation line appeared to be functioning properly during the monitoring visit. The installation of plants in the DG-4 Sheet Flow and DG-SF-1 mitigation areas appears to have been completed successfully and the issues noted during the monitoring are not expected to have an impact on the continued growth of the plants. Photo 14 in Attachment B document the mitigation area during the monitoring visit.

Minimal native plant growth was noted throughout the DG-4 Sheet Flow and DG-SF-1 mitigation area, and what was present is likely from both natural recruitment and from seeding. Native plants such as mugwort, tall flatsedge, and Canada horseweed were observed sprouting in the DG-4 Sheet Flow and DG-SF-1 mitigation areas. Native cover was estimated to be approximately 45 percent in the DG-4 Sheet Flow/DG-SF-1 mitigation area.

Nonnative weed cover in DG-4 Sheet Flow and DG-SF-1 was estimated at approximately less than five percent which is approximately 65 percent less than the level of weed cover that was observed during the previous monitoring visit. Nonnative species observed in DG-4 Sheet Flow and DG-SF-1 included poison hemlock and perennial pepperweed. All nonnative weeds observed in this mitigation area were vegetative and just starting to germinate.

3.0 RECOMMENDATIONS

3.1 Nonnative Plant Control

Nonnative weed cover was found to be approximately less than one percent to less than five percent for the Phase 2 mitigation areas. In addition, evidence of recent weed abatement activities was present in the Phase 2 mitigation areas. Because weed abatement had recently occurred in many of the mitigation areas, weed growth was just beginning to germinate and most weeds were not going to flower or seed. Regular maintenance and removal of nonnative weeds is of the highest priority for all of the mitigation areas to reduce competition between native and nonnative plants. In addition, eucalyptus stumps that are starting to re-sprout should be trimmed back frequently. A focus should be placed on removing the weeds and nonnatives from the basins of each of the container plants and cuttings; however, nonnative weeds just outside of the planting areas can migrate into the planting areas via seed dispersal. Outside of the nesting bird season, a focus should also be made to remove nonnative weeds in areas where least Bell's vireos are likely to nest during the breeding season (i.e. in the vicinity of the least Bell's vireo nest that was active in 2020). Nonnative plants and weeds that have gone to seed should be bagged and removed from the mitigation area. Without the use of herbicides, control of the nonnatives will be extremely difficult so the frequency and level of effort will need to be increased to provide control until the native plants and seedlings have a chance to grow and outcompete the nonnatives. In particular, it is important to maintain long-term perennial pepperweed management to reduce competition and allow for native plants to germinate. In addition, dodder should be removed from container plants in the mitigation areas. Although many species of dodder are native, this parasitic plant can be harmful to younger shrubs and trees that are not yet established and can even cause mortality.

3.2 Irrigation

The irrigation system was inspected for functionality and appeared to be properly installed. Irrigation was not actively occurring during the monitoring visit; however, the soil for most container plants was found to be moist at and below the surface. Some of the basins in mitigation area DG-W-1, DG-W-2, and DG-W-2 Outlet were found to be dry and the irrigation in this area should be checked for functionality. This is especially important during periods of drought and high temperatures. Some of the emitters were observed to be outside of the container plant basins, likely due to erosion, water flow, and/or public interference. Twice weekly watering events should be conducted for the container plants unless adequate rainfall occurs. After watering, the container plant basins should have at least 0.5 inch of saturation depth. Continual maintenance of the irrigation system should be conducted to ensure all plants are evenly watered and the tube emitters are placed at the base of the container plants. Watering of the seeded only areas is not recommended.

3.3 Herbivory

Rabbit herbivory of container plants was observed in the Phase 2 mitigation areas. California rose appeared to be the most affected by herbivory. Minor herbivory generally will not kill the plants, but continued monitoring should be conducted during future visits to determine the level of the herbivory isn't such that plants are dying. As the plants become more established, they will be less susceptible to the effects of herbivory. It should be noted that the cages installed by Nature's Image around container plants following container plant installation have been removed for container plants that have outgrown the cages and no longer require protection; however, if browsing by rabbits or other animals begins to worsen, additional caging around affected and/or favored container plants may be warranted.

3.4 Erosion

Erosional issues that were observed within the Phase 2 and Phase 3 mitigation areas during the previous monitoring visit that were likely caused by the December storm events did not show any signs of worsening. Significant erosion issues were generally not observed within the Phase 2 mitigation areas. However, until more native perennial plants become established in these areas, there is the potential that intense rainfall may create erosion problems. During future monitoring events, erosion should continue to be monitored in all planted areas and if warranted, erosion Best Management Practices (BMPs) should be installed in appropriate areas. This may only require the installation of straw wattles at select sites to prevent existing rills from becoming larger.

If you have any questions about the information presented in this letter, please contact me at Cadams@ecorpconsulting.com or (714) 648-0630.

Sincerely,



Carley Adams
Staff Biologist

ATTACHMENT A

Field Notes

Devil's Gate Quail
C. Lancaster 8/26/22
Phase 2

DE-W-1

- Cont. plants mostly healthy & becoming well est. w/ drought stress
- Native germ: ARTDON, ERICAN, BACSAL, AMBACA, CUSCAY, CYPERA, ERIGIRA
- Nonnative germ: BRANIK, MALPAR 41% cover → recently weeded

DE-2/NC/WOUS

- Cont. plants thriving w/ negligible stress → some Cuscuta infesting S. section
- Native germ: AMBACA, ARTDON, BACSAL, HETERA
- Nonnative germ: CONMAC 41% cover → recently weeded

DB-W-2

- cont. plants mostly healthy
→ 20-25% showing mod to severe signs of drought stress
- Native germ: ERICRA, AMBACA, XANSTR, BACSAL, HETGRA
- Nonnative germ: BRANIG, CONMAC, LEPLAT 45% cover area recently weeded
- Existing willows cont. to have branch failure

DB-W-2 outlet

- cont. plants mostly healthy → 25-30% showing signs of drought stress → some severe
- Native germ: AMBACA, ERICAN, HETGRA, BACSAL, XANSTR
- Nonnative germ: CONMAC, LEPLAT 41% cover → recently weeded

SF

- cont. plants mostly healthy negligible amount stressed
- Native germ: ARTDOR, ERICAN
- Nonnative: CONMAC, LEPLAT 45%

ATTACHMENT B

Photo Documentation



Photo 1: Overview Mitigation Area DG-W-1 (Johnson Field)



Photo 2: Overview Mitigation Area Overview Mitigation Area DG-W-1 (Johnson Field)



Photo 3: Overview Mitigation Area Overview Mitigation Area DG-2 & DG-2 WOUS

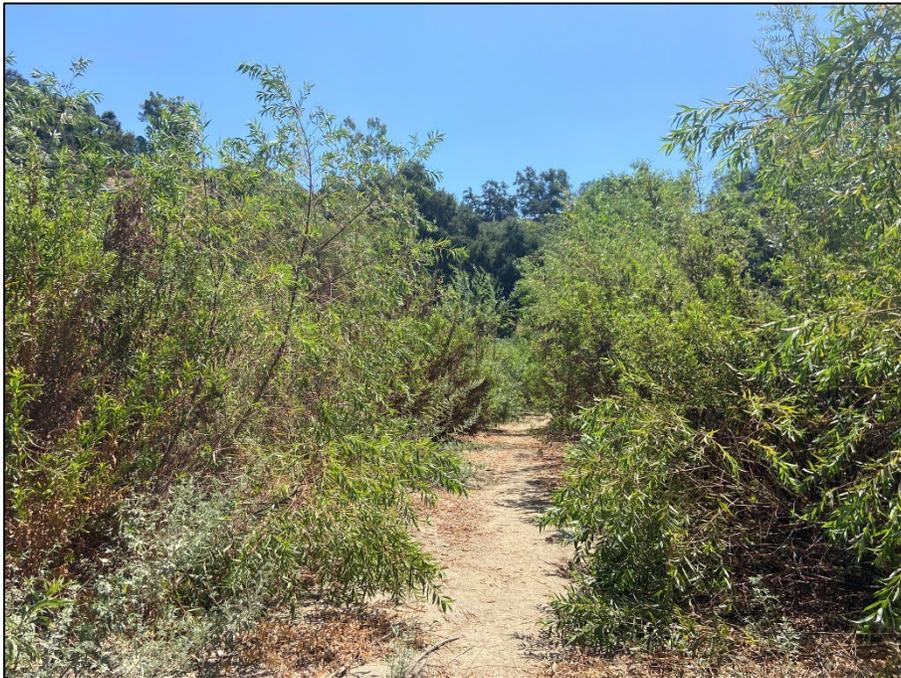


Photo 4: Overview Mitigation Area DG-2 & DG-2 New Channels



Photo 5: Overview Mitigation Area DG-2 & DG-2 WOUS



Photo 6: Overview Mitigation Area DG-2, DG-2 New Channels, DG-2 WOUS



Photo 7: Overview Mitigation Area DG-W-2 (Mining Pit)



Photo 8: Overview Mitigation Area DG-W-2 (Mining Pit)



Photo 9: Overview Mitigation Area DG-W-2 (Mining Pit)



Photo 10: Overview Mitigation Area DG-W-2 (Mining Pit Outlet)



Photo 11: Overview Mitigation Area DG-W-2 (Mining Pit Outlet)



Photo 12: Overview Mitigation Area DG-W-2 (Mining Pit Outlet)



Photo 13: Overview Mitigation Area DG-W-2 (Mining Pit Outlet)



Photo 14: Overview Mitigation Area DG-4 Sheet Flow/Sheet Flow-1



Photo 15: Overview of Grade Control Structure



Photo 16: Overview of Grade Control Structure